

Rotary encoder connection and setup

There are 2 types of rotary encoders widely used in pendants and operator panels:

- Simple rotary encoder based on 2 switches. This type of encoders usually generates around 10-40 pulses per revolution (PPR) and used as fancy style “endless multi-turn potentiometer”.




- Industrial style MPG with 100ppr and line driver 5V output

Both types can be connected to myCNC controller and used the operator control panel.

EN11 rotary encoder connection

Encoders can be connected to the galvanic isolated binary inputs. 2 Inputs are used to connect each encoder.

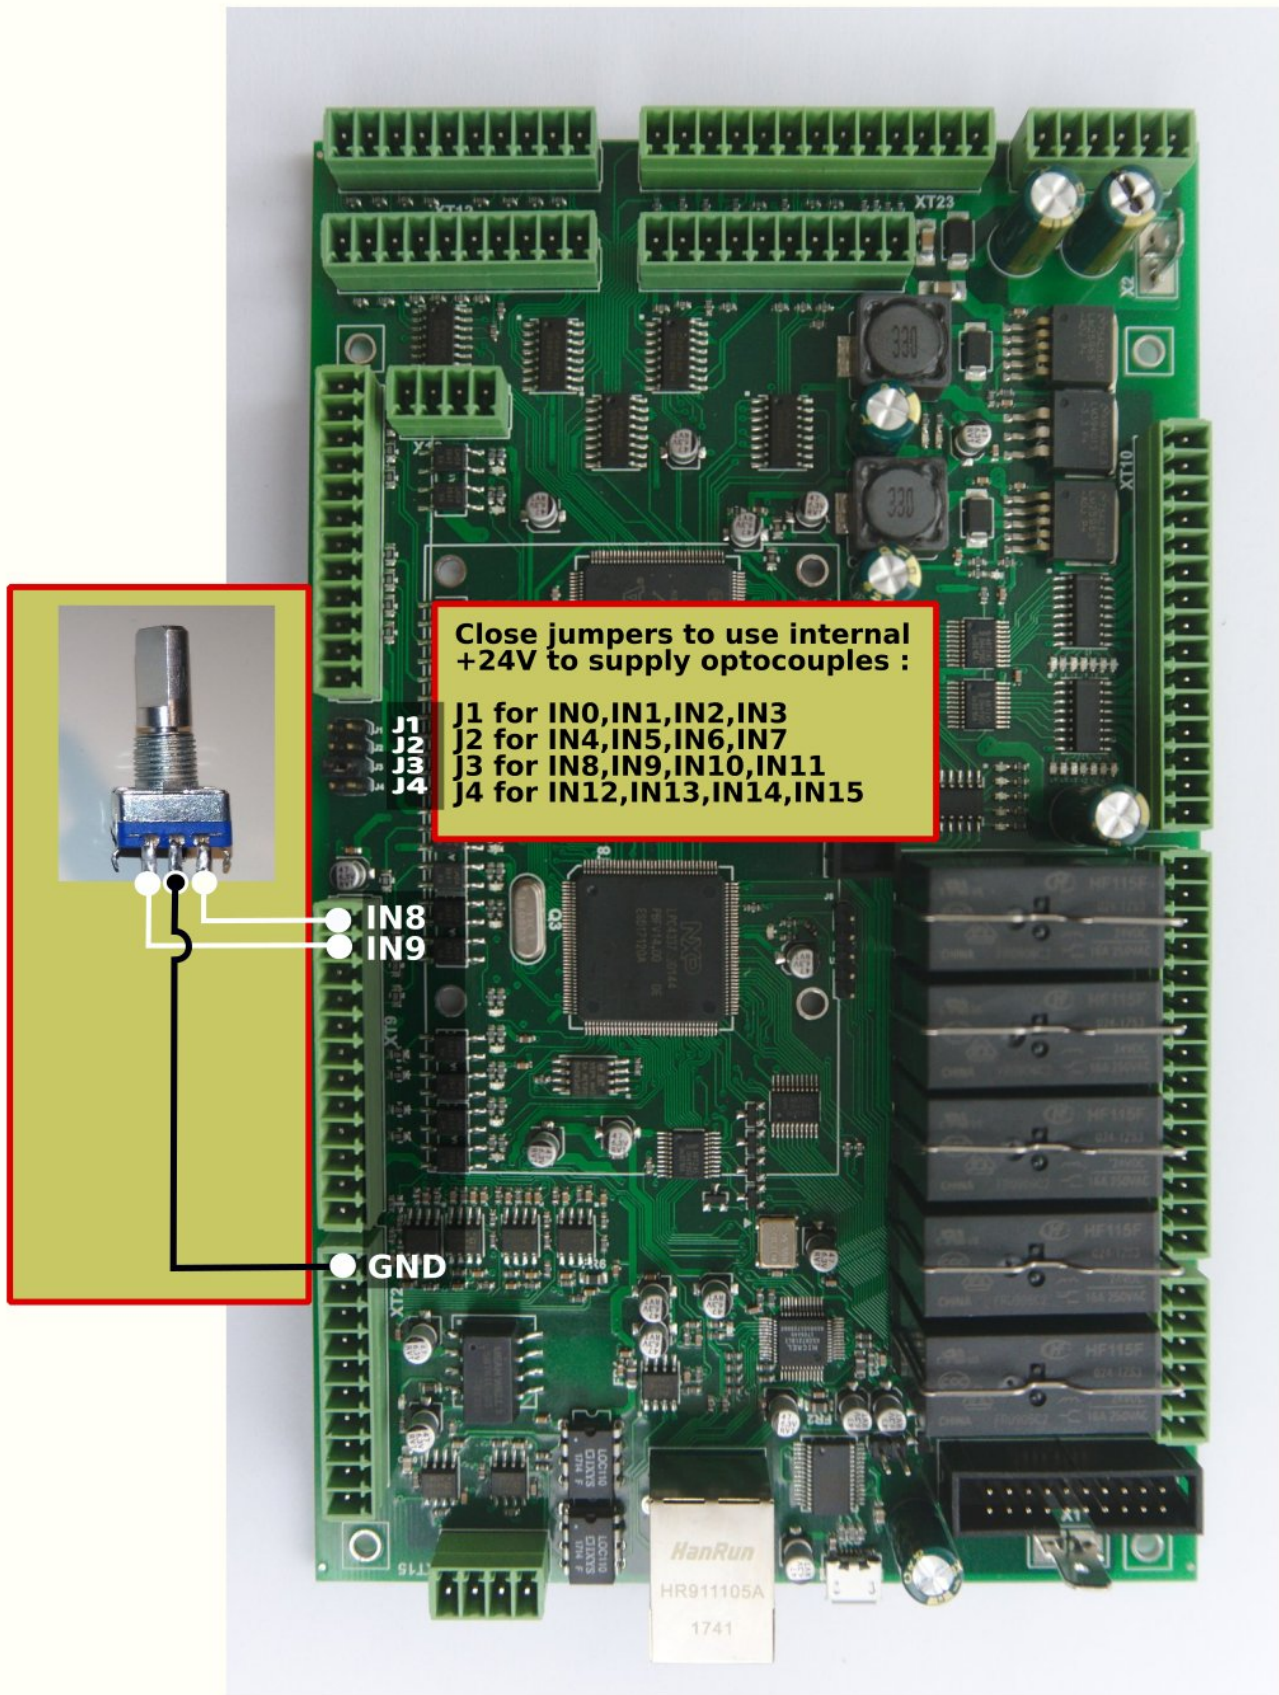


Encoder should be set up in the **Config > Inputs/Outputs/Sensors > MPG through binary inputs** configuration dialog.

myCNC controllers support up to 4 software encoders defined through binary inputs.

ET7 controller slow encoders setup

The myCNC-ET7 control board has 2 encoders (Encoder #0, #1) reserved defined permanently. These encoders are supposed to be installed on the ET7-KEY keyboard panel and connected to the 20-pin X4 connector on ET7 control board. It's possible to use external encoders without the ET7-key panel board and to connect those directly to X4 pins 11,12,13,14 and 19. See the table below for more information on the ET7 X4 pinout table:

X4 connector to External 25-keys keyboard		
Pin#	Name	Comments
11	E#0	Binary input #16, En#0 A
12	E#1	Binary input #17, En#0 B
13	E#2	Binary input #18, En#1 A
14	E#3	Binary input #19, En#1 B
19	GND	

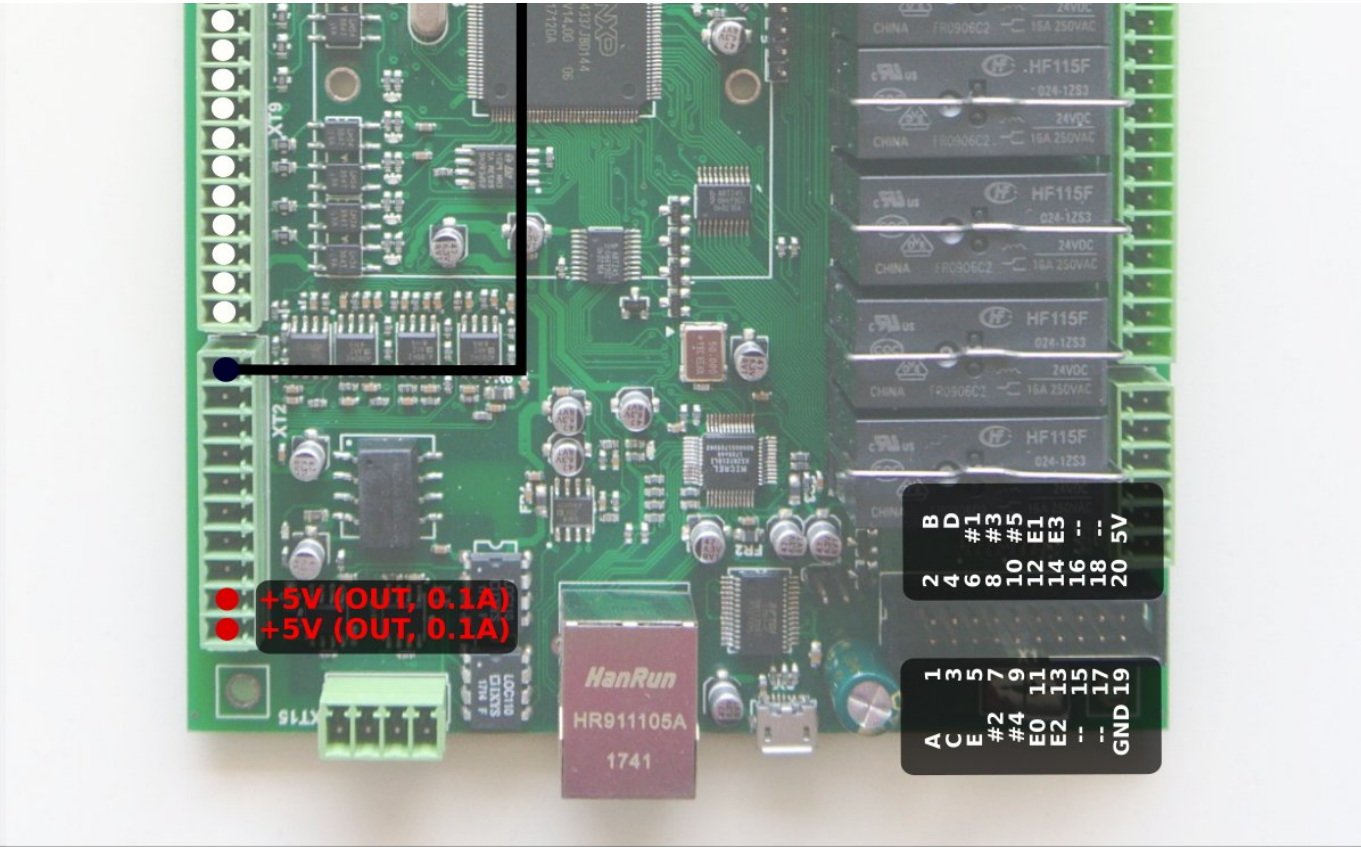

These pins are actually Binary inputs #16, #17, #18, #19 which are permanently configured as Encoder#0 and Encoder#1 in myCNC-ET7 controller firmware. This is the reason Slow Encoders #0, #1 configuration for ET7 controller in myCNC software is ignored and can be skipped. **However, Encoder #2, Encoder#3 can be attached to any or binary inputs and configured accordingly when using the ET7 board.**

For all other control boards (ET6, ET10 and ET15), the slow encoders configurations #0-3 are active and can be used by users.

Rotary encoders setup example is shown on a picture below

CNC Settings

- Axes/Motors
- Inputs/Outputs/Sensors
 - Alarms
 - X-Alarms
 - Limits
 - Triggers/Timers
 - MPG through binary inputs**
 - Jog through ADC Inputs
 - I/O Expand cards mapping
 - ADC Mapping
 - Connections
- Network
- Motion
 - PLC
 - G-codes settings
 - DXF import settings
 - Macro List
 - Macro Wizard
 - Probing Wizard
 - Preferences
 - Screen
 - Work Offsets
 - Parking Coordinates
- Technology
 - Camera
 - 5 axes RTCP
- Panel/Pendant
- Hardware
- Advanced

MPG/Encoder through binary inputs

	Input1	Input2	Slot	Axis	Dimension	Encoder Resolution
#0	16	17	MPG wheel	General Purpose		400
#1	18	19	MPG wheel	General Purpose		400
#2	0	1	MPG wheel	Pendant		65536
#3	2	3	MPG wheel	General Purpose		400

MPG/Encoder ET10 encoder inputs


	Input#	Slot	Axis	Dimension	Encoder Resolution
#4	ET10 Encoder#2	MPG wheel	X		100
#5	ET10 Encoder#4	MPG wheel	X		100
#6	ET10 Encoder#0	MPG wheel	X		100
#7	ET10 Encoder#0	MPG wheel	X		100

There are 2 encoders attached on Inputs #0,1,2,3 and set up in the dialog.

- Encoder #2 is attached to inputs #0 and #1 and used as a Pendant MPG/Wheel.
- Encoder #3 is attached to inputs #2 and #3 and used as a general purpose encoder.

For ET7 controller, Encoders #0 and #1 are connected to the X4 connector pins 11-14 (or through the ET7-KEY keyboard) and are configured despite being disabled in the myCNC settings window.

Encoder connection setup through configuration dialog.

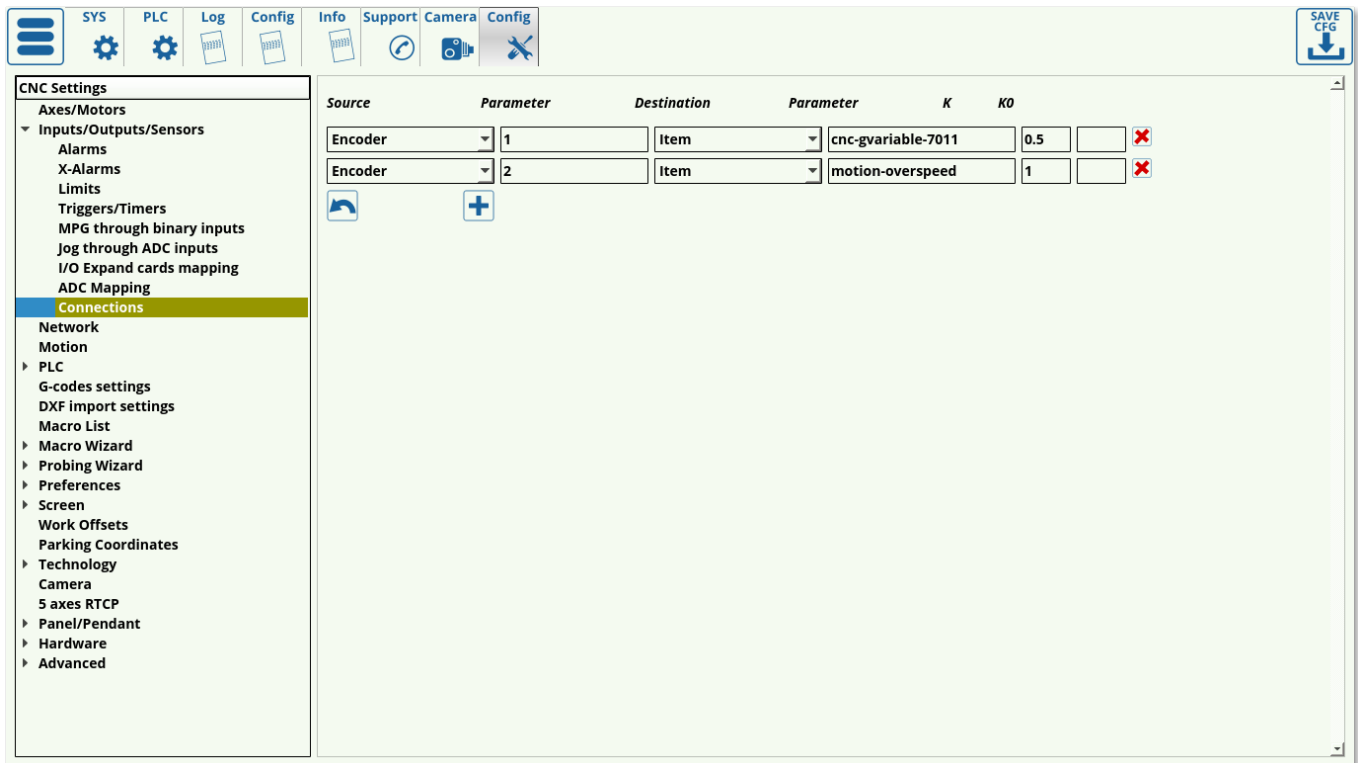

A general purpose encoder can be connected to one of the system variables for convenient control.

There is a configuration dialog (described further in the [MyCNC Configuration Dialogs](#) manual) which can be used to set up a connection between slow encoder values and CNC parameters.

- Source - a source of connection - can be an Encoder, ADC, input/output pin, PWM, a global variable or other parameters
- Source/Parameter - address of the source. It can be Encoder number, input pin number, global variable address etc
- Destination - destination connection
- Destination/Parameter - destination address
- K - destination ratio. For example, Spindle speed will be increased 100RPM every encoder clicks if "K=100".
- K0 - destination shift ratio. Usually left to be at 0 (field left to be blank).


On-panel rotary encoders are mostly used to control the following values on-the-fly:

- Overspeed [%]
- THC Arc reference voltage [V] (actually cutting height)
- Spindle speed

A rotary encoder should be connected to the XML configuration Item "motion-overspeed" to control Overspeed [%]

Global variable register 7011 is used to change on-the-fly Cutting height (THC Arc reference voltage)

To change Spindle speed, the XML Item "spindle-default-speed" can be used.

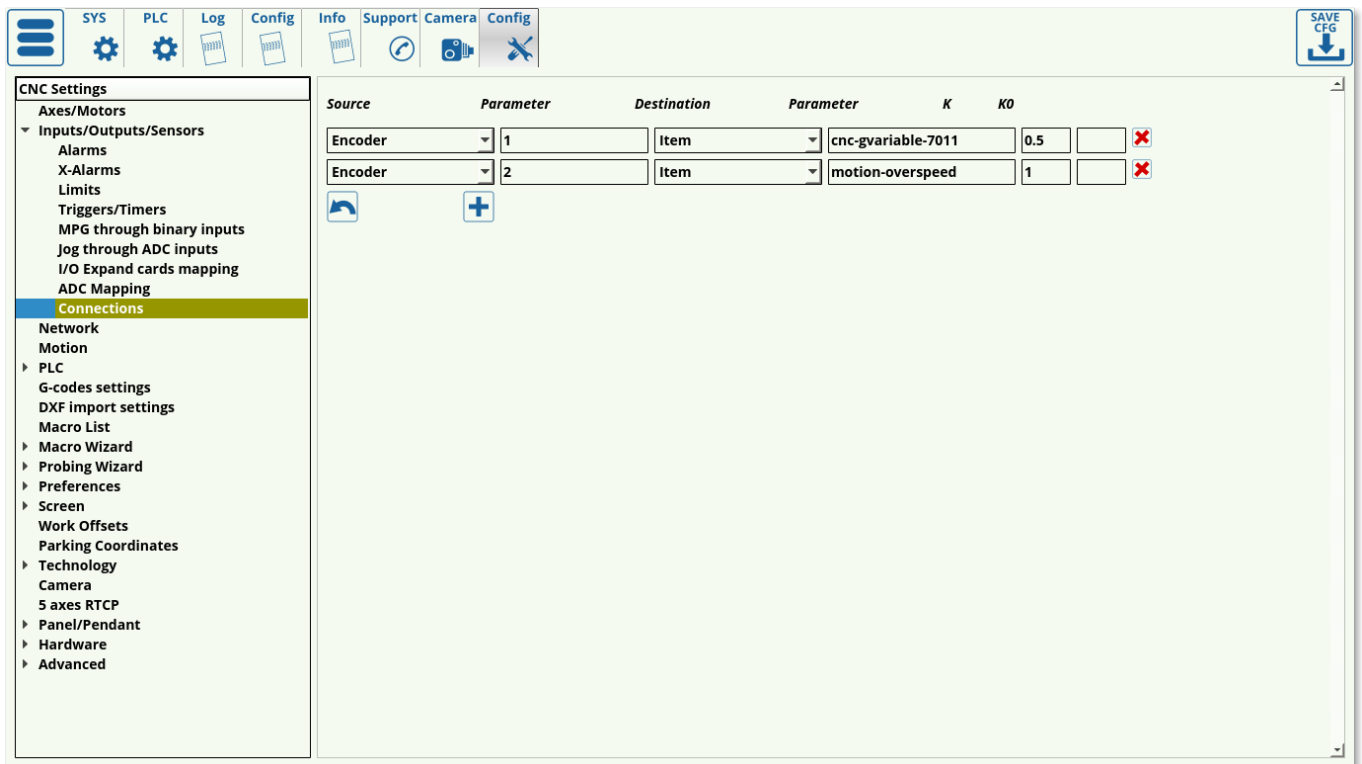

A further selection of commonly used Items can be found in the [Common Item List](#) manual.

Obsolete method to establish connection through "cnc-variables.xml" configuration file.

This method was used before the dialog described above was released. Only used on the old deprecated software versions

The connection assignment can be written directly in the cnc-variables.xml configuration file. For example:

```
<value name="cnc-connection-item-002"
source="encoder:3"
dest="item:motion-overspeed" >0</value>
```

- **source="encoder:3"** - encoder #3 defined as a source
- **dest="item:motion-overspeed"** - **motion-overspeed** defined as destination

Encoder #3 connected to **motion-overspeed** variable. Overspeed (%) value will be changed by rotating the encoder.


```
<value name="cnc-connection-item-003"
source="encoder:2"
dest="item:cnc-gvariable-7012">0</value>
```


- **source="encoder:2"** - encoder #2 defined as a source
- **dest="item:cnc-gvariable-7012"** - Global variable for THC Arc Voltage Adjustment value is a

destination for the connection

Encoder #2 is connected to the THC Arc voltage adjustment. Adjustment Arc value will be changed to "+1" or "-1" on every encoder click.

Encoder connection troubleshooting

1. Go to the Diagnostics page in myCNC software and check which binary input pins the encoder is attached to. To do so, monitor the binary inputs section of the Diagnostics page as you turn the encoder - the relevant input pins should blink as the encoder dial is moved. The input pins #18 and #19 are used in this example, as can be seen in the following picture: 
2. Check that the "Slow Encoder" values are changed while you turn the encoder.
3. Check that the Destination item value has changed while you turn the encoder.
4. After the checkup has been complete, reload the program to refresh the settings to the newest configuration.

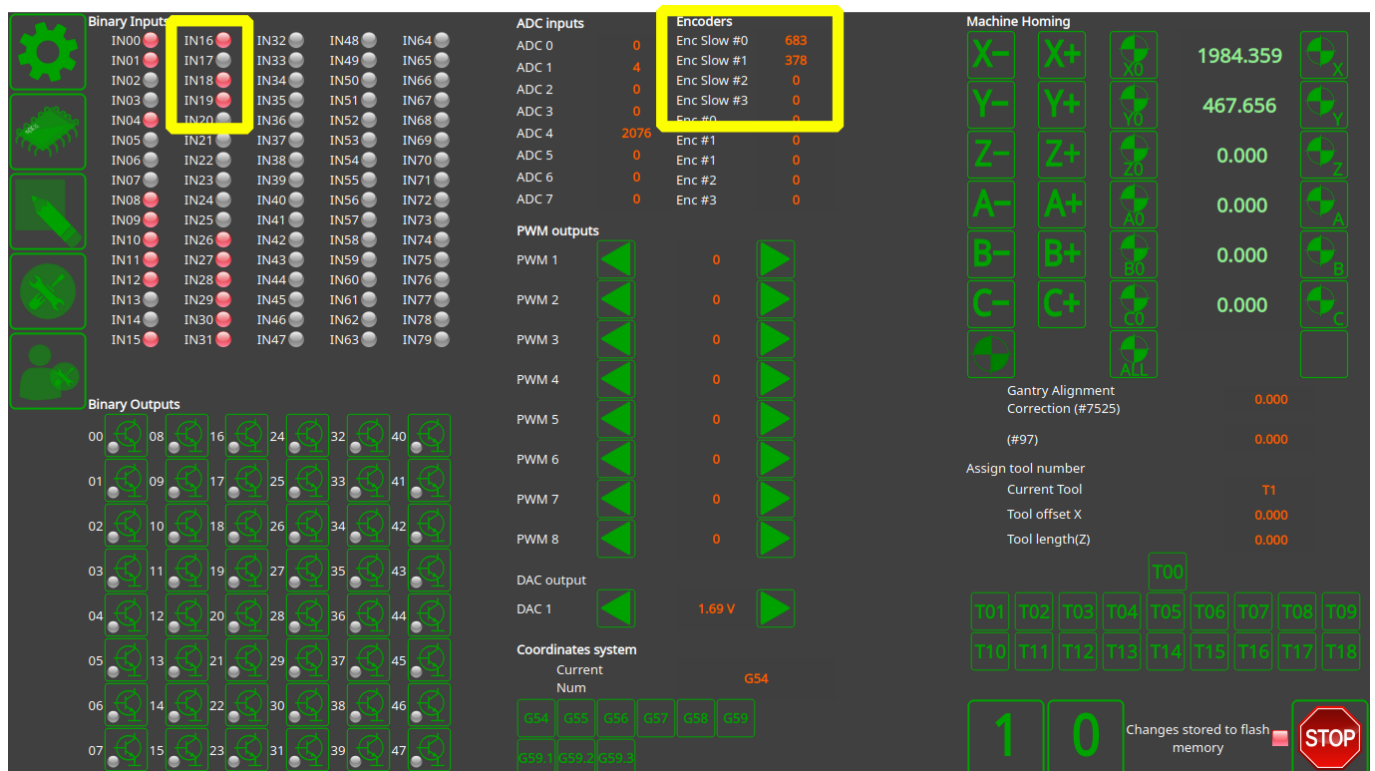



Video

Closed-loop setup

Read more about the topic in the [MyCNC closed loop configuration manual](#).

The following window is available upon navigating to Settings > Config > Hardware > Encoders:

Encoders	#0	#1	#2	#3	#4	#5	#6	#7	#8	#9
Encoder Resolution	2500	2500	2500	2500	2500	2500	512	512	512	512
Current value	9999	9999	9999	0	0	0	0	0	0	0
Z position	0	0	0	0	0	0	0	0	0	0
Mul	0	0	0	0	0	0	0	0	0	0
/(2^Div)	1	1	1	1	1	1	1	1	1	1
Encoder Position	0	0	0	0	0	0	0	0	0	0
Position										
Linear Encoder Dimension	0.005	0.005	0.005	0.005	0.005	0.005	0.005	0.005		


The following settings are available:

- Encoder resolution for each particular encoder number.
- The current encoder value is displayed on this screen. This is the fastest way to check if the encoder is connected/working - for example, turning an MPG wheel handle should immediately change the current encoder value in this field for the selected encoder.
- Z-position
- Mul coefficients (multiplication value), and
- $/(2^{\text{Div}})$. These Mul and Div coefficients are used due to the fact that the controller cannot handle floating number data in calculations, therefore it is necessary to first multiply and then divide a number by certain coefficients. They are used to bring the value of the encoder in line with the pulses/unit value specified in the Axes/Motors tab. Larger numbers allow to reduce the error. For example, if the ratio between the Axes/Motors value and the encoder pulse/unit value is 3.5, then the multiplication value (Mul) can be set to 7, while Div can be set to 1 ($2^1 = 2$, $7/2 = 3.5$).
- Encoder position
- Position
- Linear encoder dimension. This should be set to the proper encoder dimension to convert the impulses from a linear encoder to mm (the most common values for this setting are 1 and 5 micrometers, as shown in the screenshot).

The following global variables deal with encoder values:

9000	<p>(+16) Registers represent Encoder values. Writing to this registers does not affect anything. Selected channel Current Encoder value will be returned when reading these registers. Reading these registers from the controller Hardware PLC will return actual Encoder value. Encoder values in the software are updated about every 128ms. This delay should be counted when using Encoder values from the Software PLC.</p> <p>9000 - Encoder #0 value 9001 - Encoder #1 value 9002 - Encoder #2 value 9003 - Encoder #3 value 9004 - Encoder #4 value 9005 - Encoder #5 value 9006 - Encoder #6 value 9007 - Encoder #7 value</p>
9200	+16. Reserved to display the encoder position on an infinite scale (no value turnover on every full encoder turn, instead the value will keep climbing indefinitely into the positives/negatives depending on where the encoder handle is spun)
9216	+16. Reserved to display the encoder position on an infinite scale WITH the current encoder dimension (to indicate the current encoder position)

These global variables allow to display encoder values on the main screen of myCNC profiles that are geared towards encoder setups (such as 1366M4E and 1366PE):

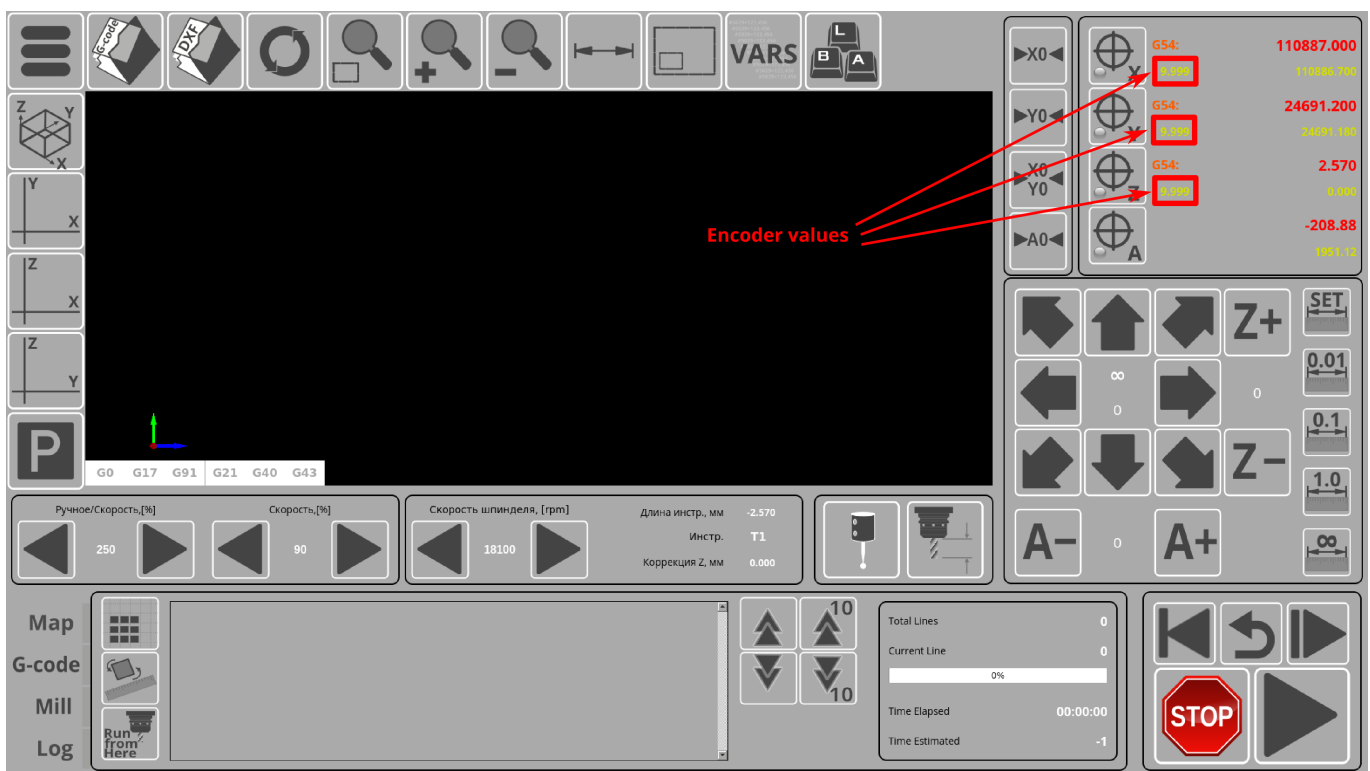

From:
<http://cnc42.com/> - myCNC Online Documentation

Permanent link:
http://cnc42.com/mycnc/rotary_encoder_connection_and_setup?rev=1573144897

Last update: 2019/11/07 11:41



