


Setting up the probe tool


The probe tool is currently being sold as part of some myCNC kits. The main sensor looks like the image below:

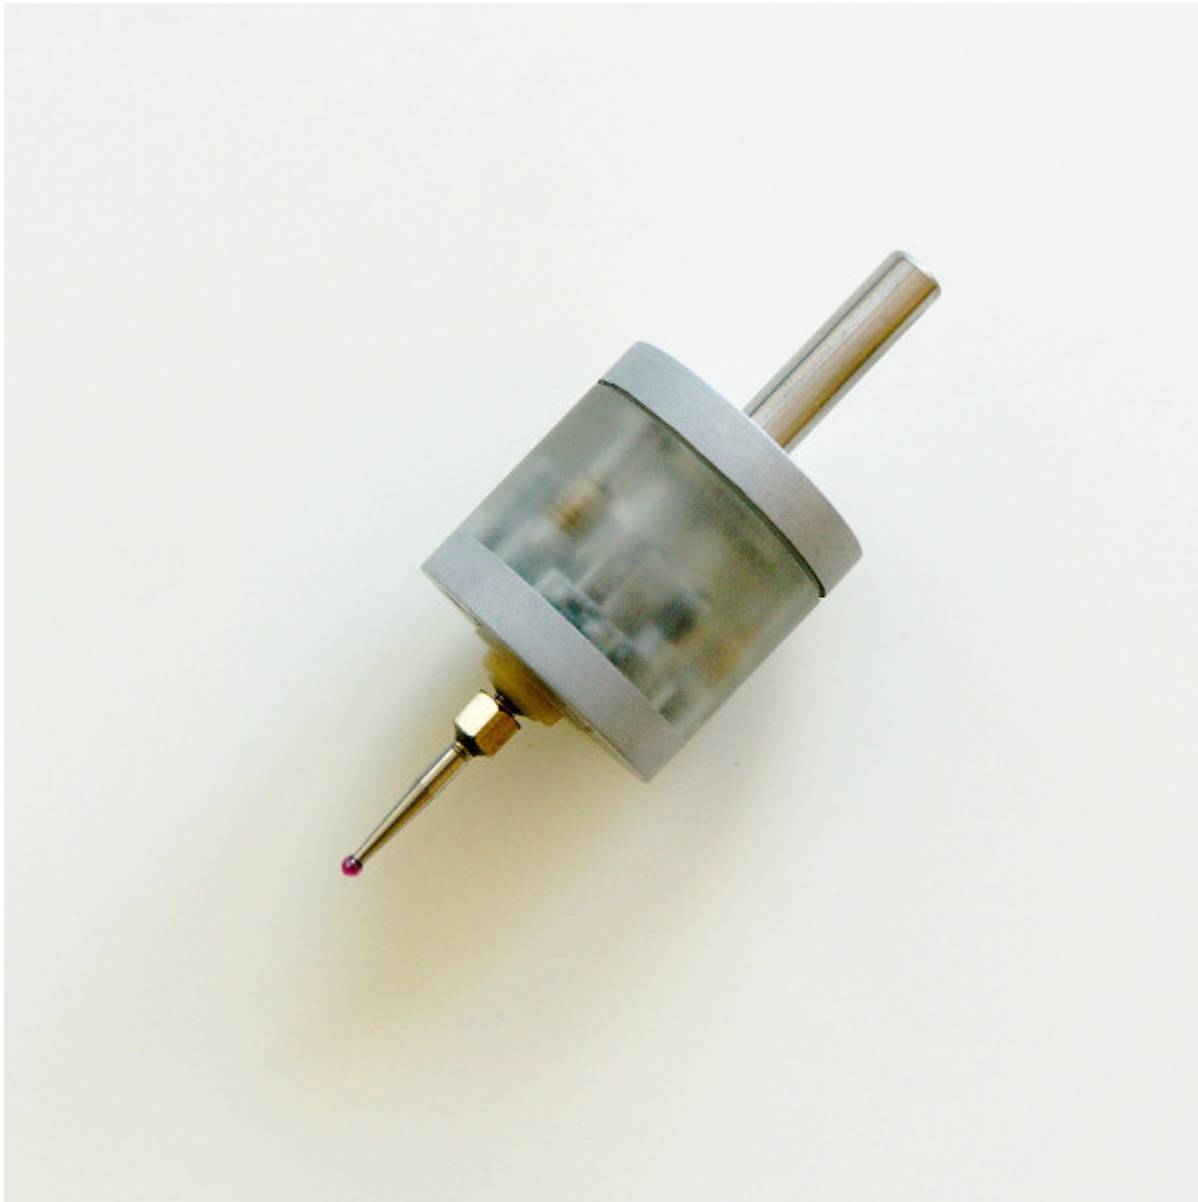

This manual covers the basic setup of the probe that can be used in a number of myCNC profiles and applications in order to determine an exact position of the part on a milling machine. The probe can find edges, corners, hole centers, and more.


Calibration/Adjustment of the probe sensor

In order to properly adjust the probe before starting the measurement procedure, it is necessary to eliminate any deviation that might be otherwise present in the probe. For this purpose, an indicator is used, as shown in the image below. This indicator should be sensitive to small forces of about 0.3-0.5H.

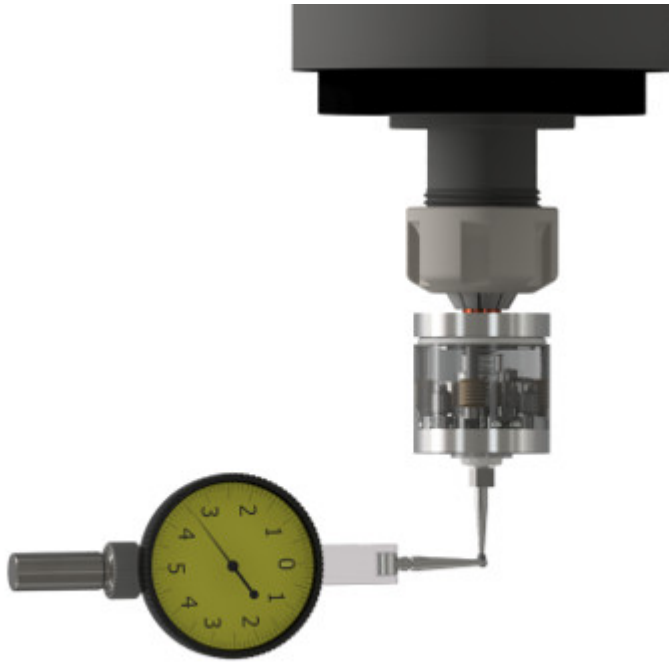

The spindle axis is moved by hand, and the amplitude of the sensor deviation is recorded using the indicator.

The deviation is eliminated by turning the M2.5 adjustment screws (shown in the image below) with the 2mm hex key provided in the probe kit:

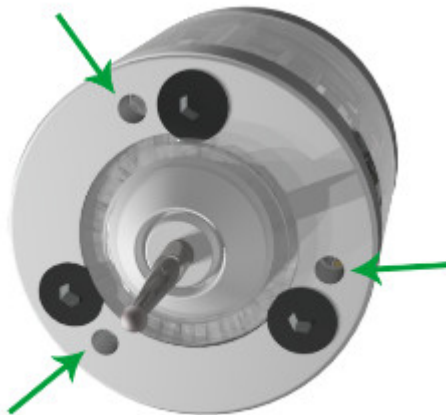



It is recommended to hold the hex key by its short lever as shown in the image below, in order to prevent excessive force application. It might be necessary to perform several cycles of spindle calibration to adjust the probe to have the minimum acceptable deviation.




Connection to the myCNC board

In order to set up this probe sensor with a myCNC controller, please consult the diagrams below. Note that while the setup is shown in one particular configuration on the ET7 myCNC control board, it can be replicated on other boards and in other connection configurations as well:

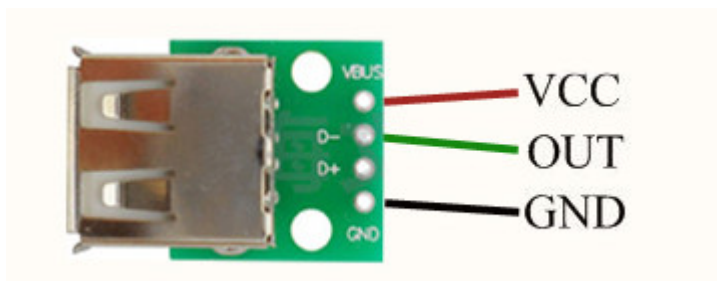

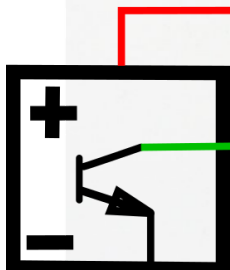

particular setup, please close the proper jumper for each respective group.

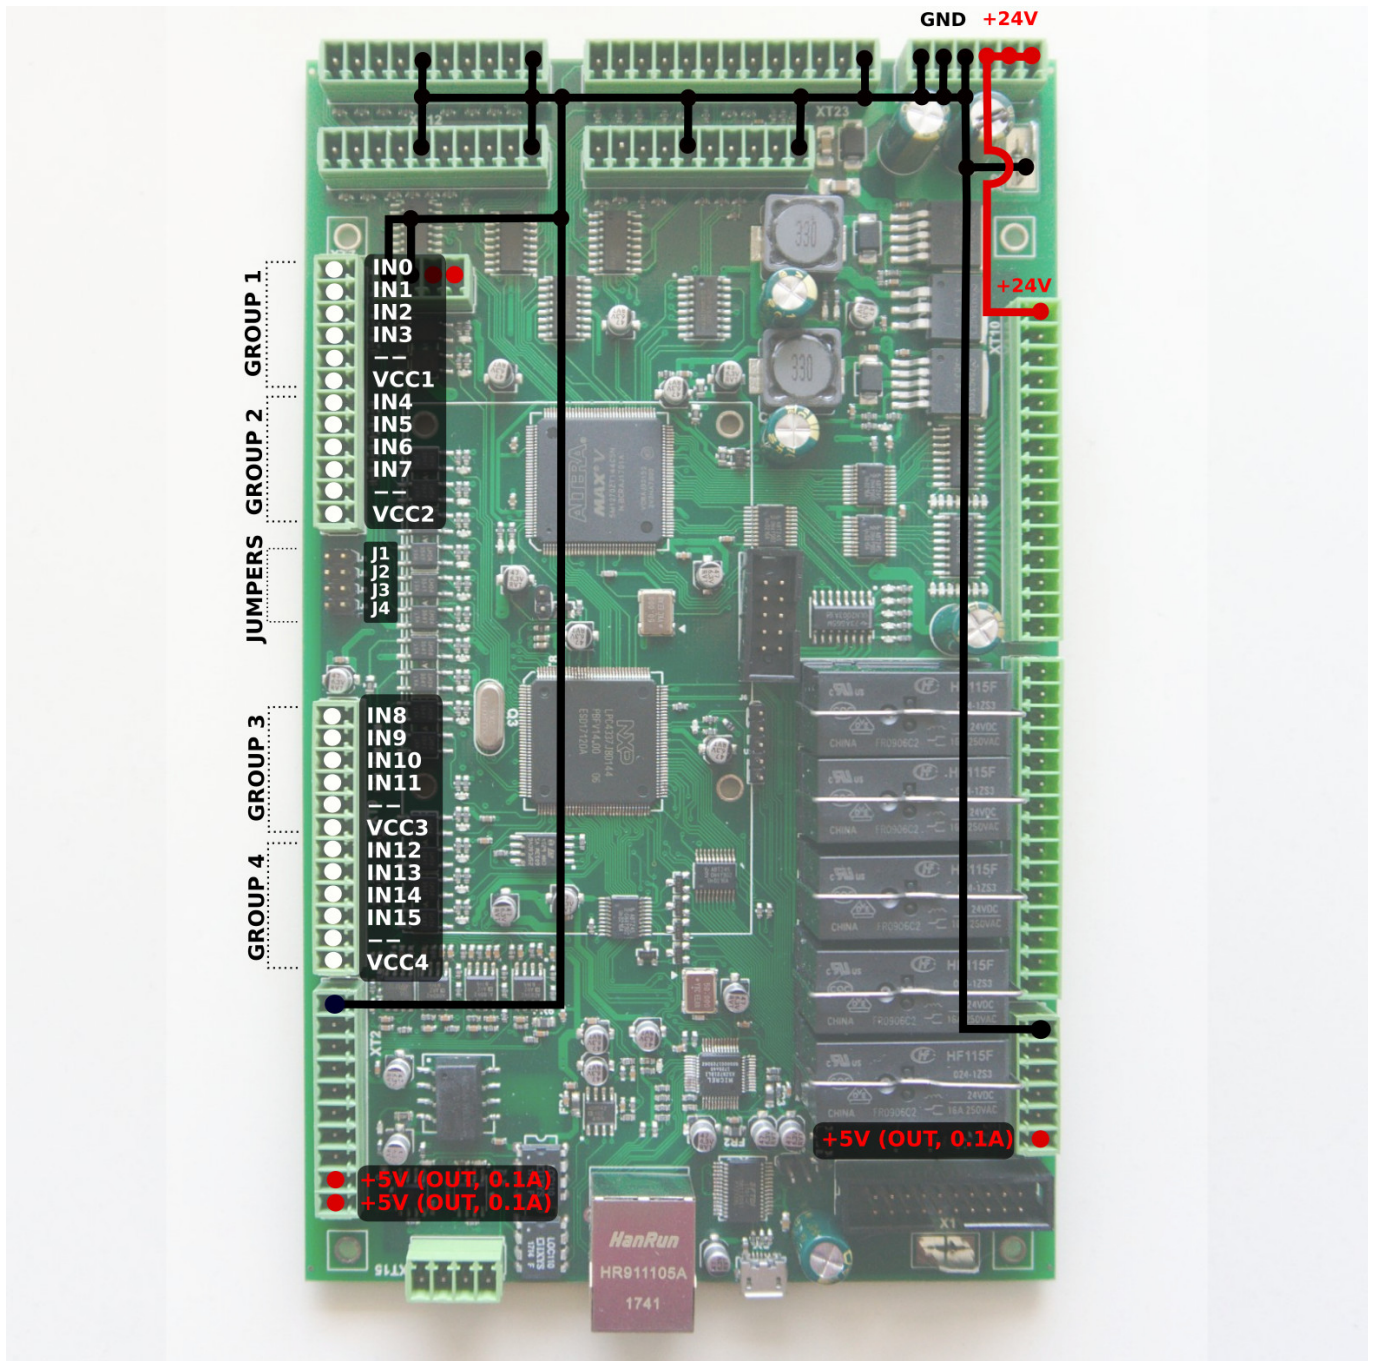

Probing Wizard Setup in Mill profile

In order to properly set up a probe system on a mill profile from scratch on your machine (especially if the software has not, for any reason, been updated to its latest version) please check the following:

1. In **CNC Settings > PLC > Hardware PLC**, check that the command **TRIG04** is created. The program should contain the following code:

```
main()
{
    gvarset(9122,1);  timer=30;do{timer--;}while(timer>0); //show message

    if (gvarget(6060)!=0x57)
    {
```

```
message=PLCCMD_MOTION_BREAK;
timer=30;do{timer--;}while(timer>0);

};

exit(99);
};
```

The screenshot shows the CNC Settings application with the 'PLC' tab selected. The left sidebar lists various settings, including 'Hardware PLC' and 'Probing Wizard'. The main area displays the 'TRIG04' macro configuration. The 'Name' field is 'TRIG04' and the 'Aliases' field is empty. The 'main()' function is defined as follows:

```
main()
{
  gvarset(9122,1); timer=30;do{timer--;}while(timer>0); //show message

  if (gvarget(6060)!=0x57)
  {
    message=PLCCMD_MOTION_BREAK;
    timer=30;do{timer--;}while(timer>0);
  };

  exit(99);
};
```


The 'PLC Sources' list includes M288, M397, M398, M399, M62, M63, M71 (:), M74 (:), M79, M80, M81, M82, M85, M87, M88, M89, OFF, SPN, and ST001. The 'PLC Includes' list includes func.h, mill-func.h, pins.h, probe_func.h, and vars.h. The 'Status' section on the right shows the following status:

- M81: OK
- M82: OK
- M85: OK
- M87: OK
- M88: OK
- M89: OK
- OFF: OK
- SPN: OK
- ST001: OK
- TRIG04: OK

2. In **CNC Settings > Probing Wizard > Probing Macro Wizard**, click **Generate All Probing Macros** and **Generate PLC Probing procedure M288**. Among other settings, this generates the necessary windows for the popup screens of the probe sensor (popups 20, 21 and 22).

The screenshot shows the CNC Settings application with the 'PLC' tab selected. The left sidebar lists various settings, including 'Hardware PLC' and 'Probing Wizard'. The main area displays the 'Probing Macro Wizard' interface. The 'Macro header' and 'Macro footer' fields are empty. The 'M288 main() header' field is empty. The 'Tool Lift' section shows a grid of icons for tool lift, including a 'Z' icon. The 'Generate All Probing Macros' and 'Generate PLC probing procedure M288' buttons are highlighted with a red box.

3. If you want to set the particular port that you are using for your sensor, go to **CNC Settings > Probing Wizard > Probing Config** and click the **Enable Probe sensor protection** button after setting the particular port desired (Port 9 for this example). This setting will be automatically mirrored in the **CNC Settings > Triggers/Timers** window.

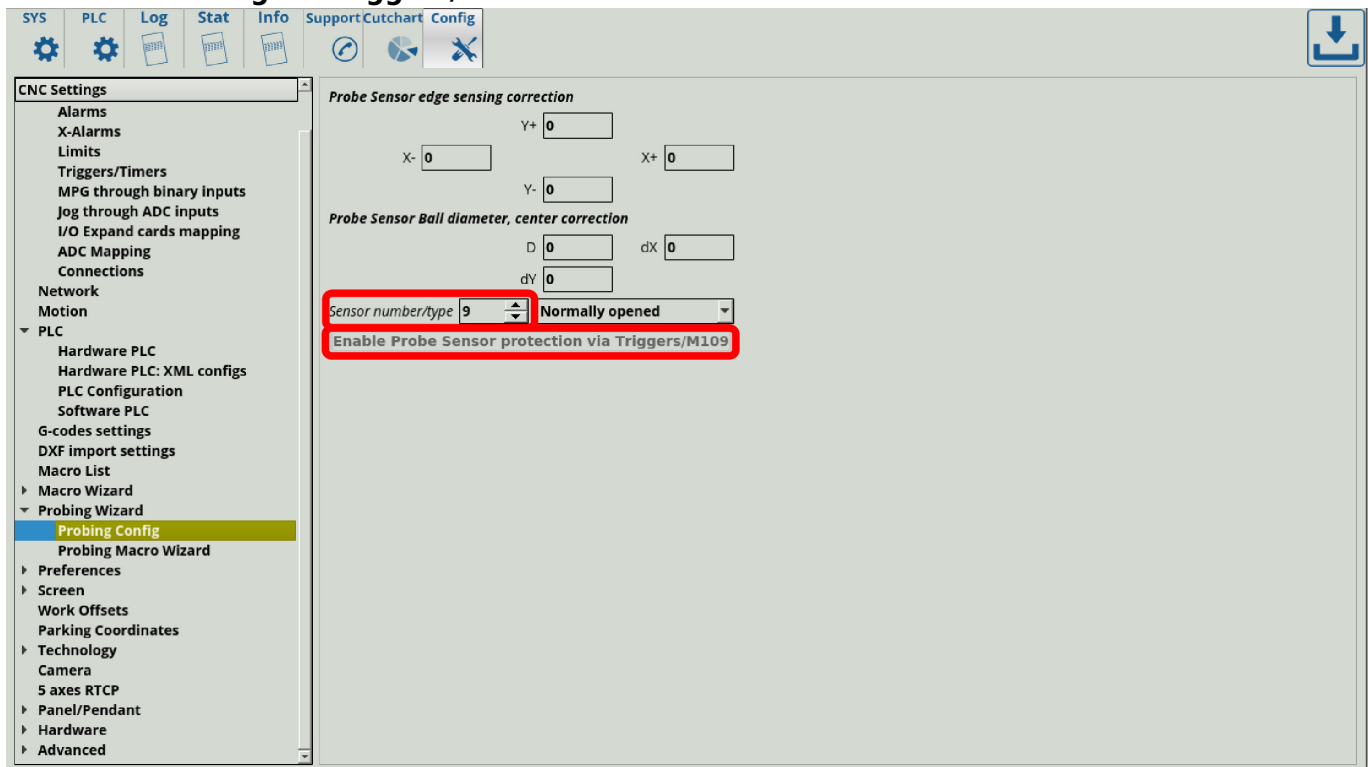


4. Double-check the TRIG04 procedure from Step 1, and edit it back to the code above if it had been changed (this can occur on older versions of the software).

The probe wizard setup should now be complete.

Using the probe sensor in myCNC software

After the probe has been successfully connected, it can be used from within myCNC software. The probe sensor window can be opened from the main profile screen, and looks like this:

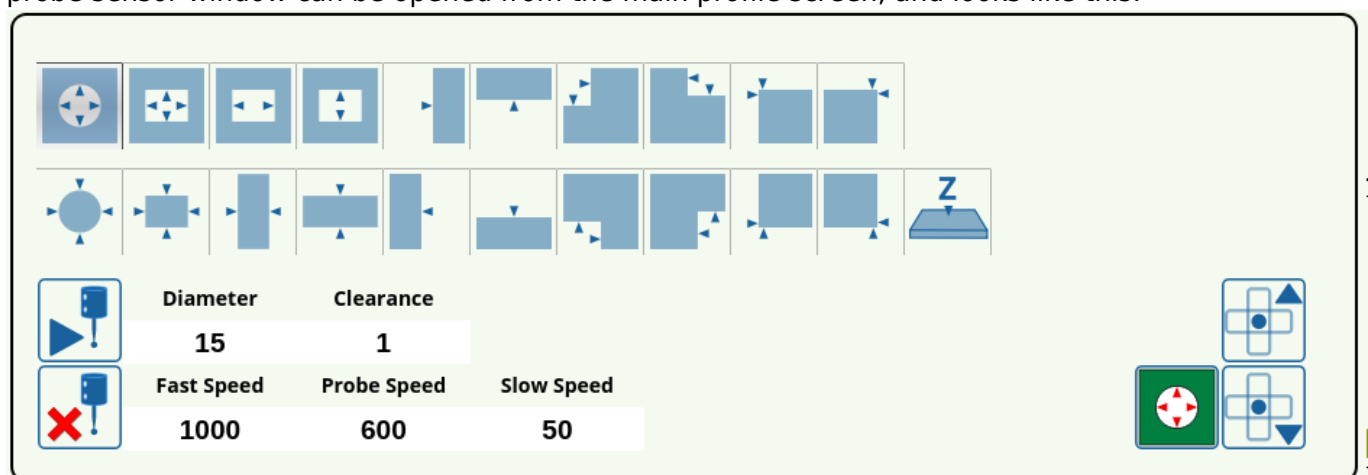


The full description of buttons for this window can be found in the [screen description manual](#).

Probe tools currently available

The currently available CNC touch probe tools are the Wired Probe Sensor (SEN-PR-WR01), the Wireless Probe Sensor (SEN-PR-WL01), and the Wired Tool Setter (SEN-TS-WR01). The specifications and technical characteristics for each of these tools can be found below.


Wired Probe Sensor (SEN-PR-WR01)

- Unilateral repeatability: <0.003 mm
- Search directions: $\pm X$, $\pm Y$, $-Z$
- Deflection in XYZ directions: ± 4 mm
- Force to decouple in XY direction: from 0.5 to 0.8 H
- Force to decouple in Z direction: 2H
- Power supply: +5V
- Current consumption: <4mA

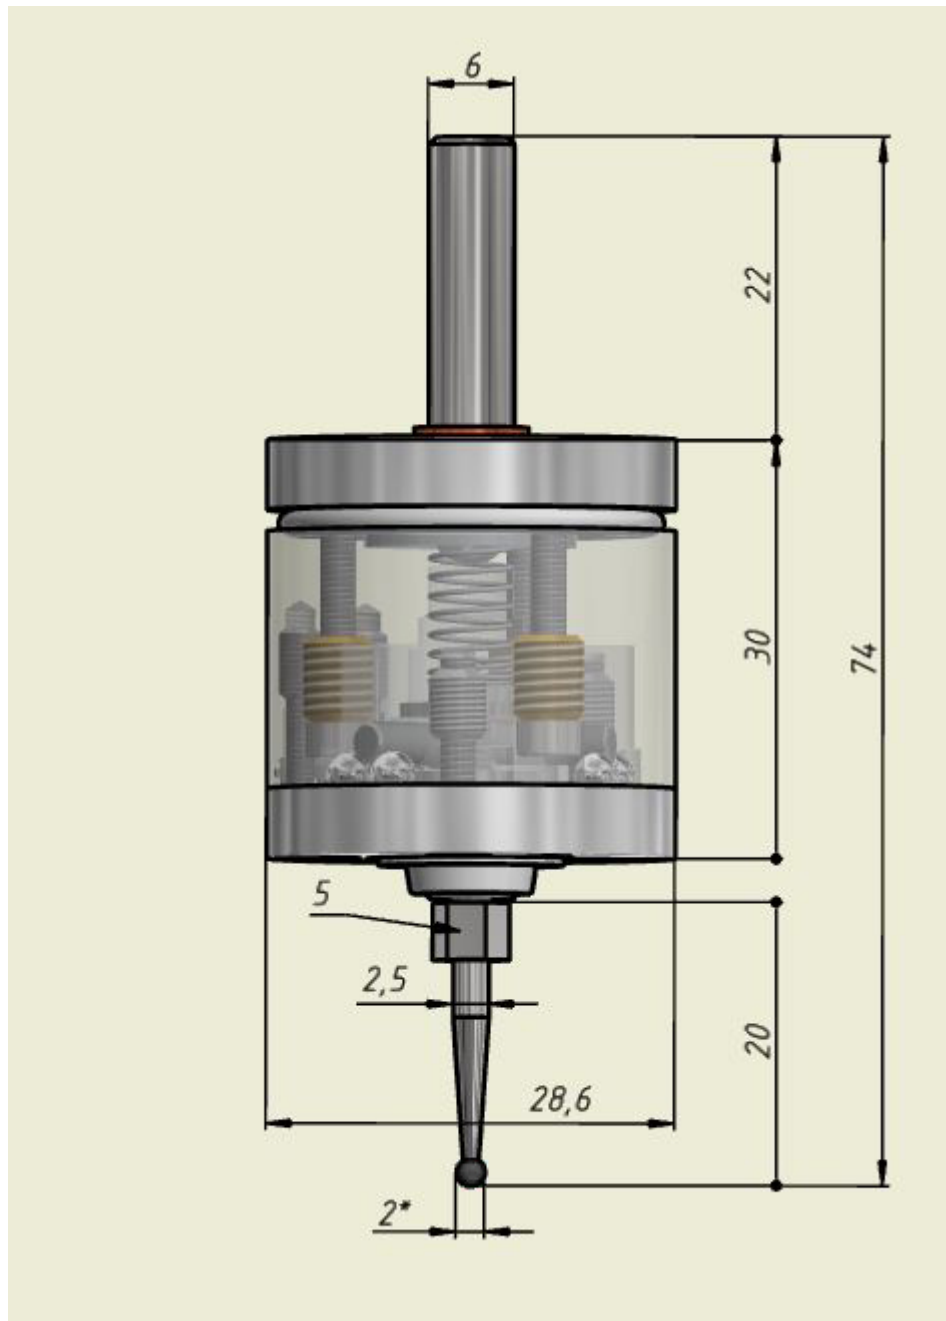

Wireless Probe Sensor (SEN-PR-WL01)

- Unilateral repeatability: <0.003 mm
- Search directions: $\pm X, \pm Y, -Z$
- Deflection in XYZ directions: ± 4 mm
- Force to decouple in XY direction: from 0.5 to 0.8H
- Force to decouple in Z direction: 2H
- Latency delay: < 2 ms
- Error detection delay: < 0.33 ms
- Probe power supply: CR2032 3V
- Probe current consumption: <0.6 mA
- Receiver power supply: 5-12V
- Receiver current consumption: 35 mA
- Radio channel radius: 6 meters
- Radio frequency: 2.4 GHz

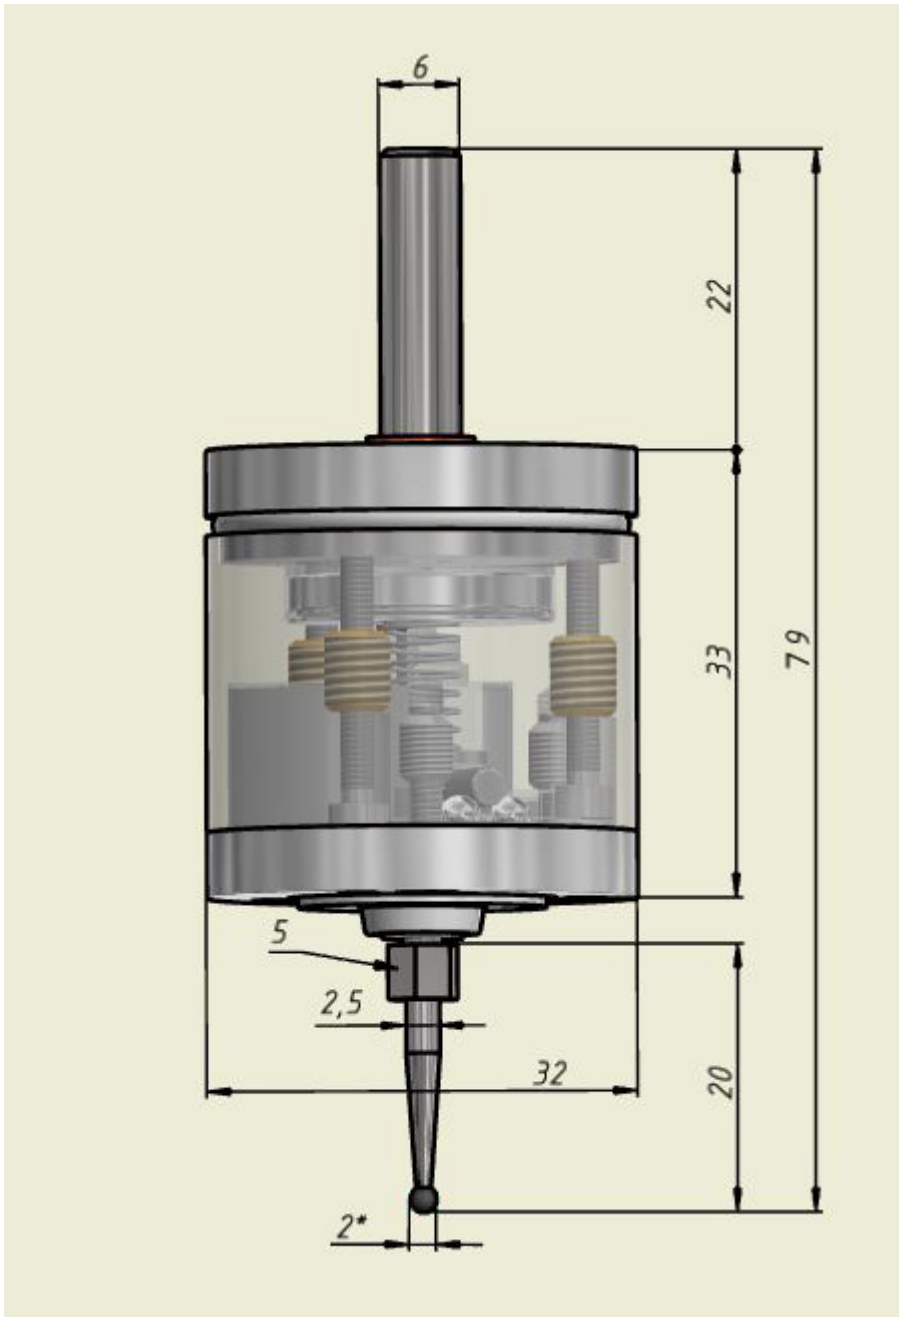

Wired Tool Setter (SEN-TS-WR01)

The tool setter is designed to determine the exact coordinates of the tool mounted on a CNC milling machine using the contact method. The CNC system generates these coordinates as the tool comes into contact with the tool setter measurement platform, and uses them to calculate the height and diameter of the tool, to link the machining program to the work tool location.

- Unilateral repeatability: <0.003 mm
- Search directions: $\pm X$, $\pm Y$, $-Z$
- Deflection in XYZ directions: ± 2 mm
- Force to decouple in XY direction: from 0.5 to 2H
- Body diameter and length: D=28mm, L=60mm
- Base size: 28x28mm
- Diameter and height of the ceramic pad: D=10mm, h=2.5mm

- Power supply: +5V
- Current consumption: >4mA
- Features dust and splash protection
- Features a brittle safeguard fuse

From:

<http://cnc42.com/> - **myCNC Online Documentation**

Permanent link:

http://cnc42.com/quickstart/mycnc-quick-start/probe_setup?rev=1562254821

Last update: **2019/07/04 11:40**

